




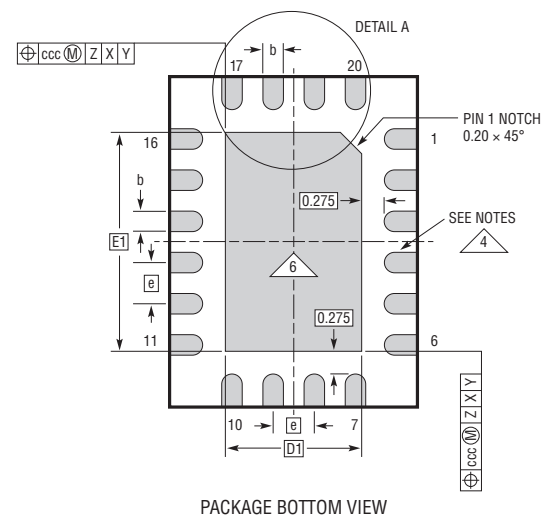

The diagram shows the top view of a rectangular package. A shaded square in the top-left corner is labeled "PIN 1 CORNER" with a triangle containing the number "5". Dimensions are indicated by arrows: "D" for the width, "E" for the height, "X" for the distance from the right edge to the center of the pin 1 corner, and "Y" for the distance from the bottom edge to the center of the pin 1 corner. Symbols for dimensions are shown in boxes: a circle for "D", a square for "E", a square for "X", and a square for "Y". The text "PACKAGE TOP VIEW" is centered below the diagram.

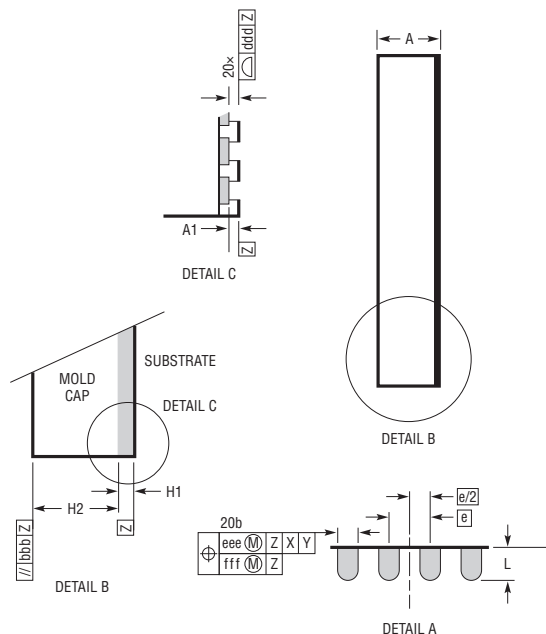

- NOTES:
1. DIMENSIONING AND TOLERANCING PER ASME Y14.5M-1994
 2. ALL DIMENSIONS ARE IN MILLIMETERS
 3. PRIMARY DATUM -Z- IS SEATING PLANE
- 4 METAL FEATURES UNDER THE SOLDER MASK OPENING NOT SHOWN SO AS NOT TO OBSCURE THESE TERMINALS AND HEAT FEATURES
- 5 DETAILS OF PIN 1 IDENTIFIER ARE OPTIONAL, BUT MUST BE LOCATED WITHIN THE ZONE INDICATED. THE PIN 1 IDENTIFIER MAY BE EITHER A MOLD OR MARKED FEATURE
- 6 THE EXPOSED HEAT FEATURE MAY HAVE OPTIONAL CORNER RADII

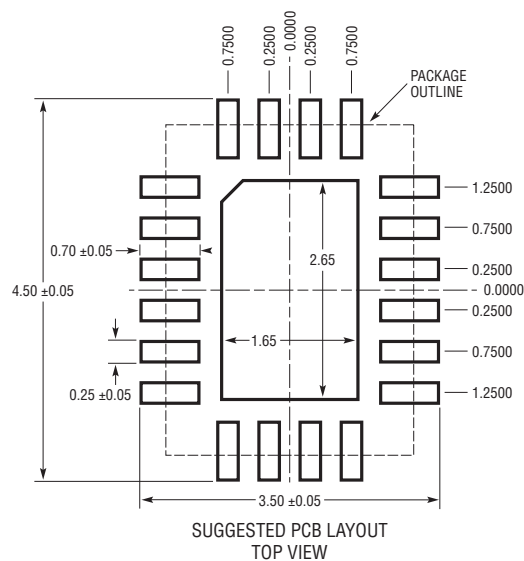

DIMENSIONS				
SYMBOL	MIN	NOM	MAX	NOTES
A	0.65	0.74	0.83	
A1	0.01	0.02	0.03	
L	0.30	0.40	0.50	
b	0.22	0.25	0.28	
D	3.00			
E	4.00			
D1	1.65			
E1	2.65			
e	0.50			
H1	0.24 REF			SUBSTRATE THK
H2	0.50 REF			MOLD CAP HT
aaa			0.10	
bbb			0.10	
ccc			0.10	
ddd			0.10	
eee			0.15	
fff			0.08	

